





ZDBMW4CS

4" (100mm) 2-Way Component Speakers for BMW

Features

- Silk Dome Tweeter
- Multi-Fit Brackets
- Switchable Bass Blocker
- Aluminium Cone Midrange
- High Quality 2-Way Crossover
- Plug & Play For BMW and MINI Vehicles

120W MAX POWER 60W RMS



SPECIFICATIONS


Speaker Type:	2-Way Component Speaker
Speaker Size:	4" (100mm)
Frequency Response:	120Hz - 20kHz
Power Handling (RMS):	60W
Power Handling (MAX):	120W
Impedance:	4Ω
Sensitivity:	86dB (1W/1m)
Voice Coil:	1" (25.5mm)
Crossover Frequency:	3300Hz (12dB/Oct)
Bass Blocker Switch:	120Hz (12dB/Oct)
Unit:	Sold as pairs

T/S PARAMETERS


Re:	3.2 Ohm
Fs:	112 Hz
Qms:	3.634
Qes:	0.793
Qts:	0.635
Cms:	393.054 μM/N
Vas:	1.41 L
BL:	3.77 N/A
Sd:	52.8 cm ²
Mms:	5.07 g
No:	0.25 %



FREQUENCY RESPONSE

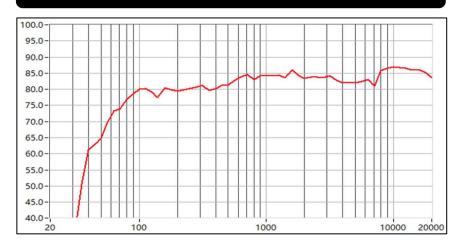

DIMENSION DRAWING

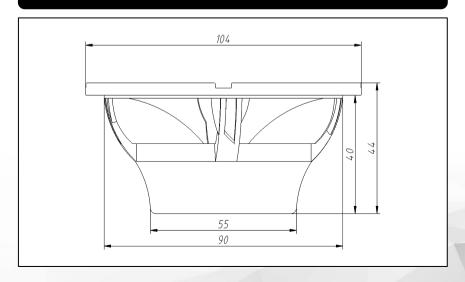

© 2025 Phoenix Gold - www.phoenixgold.com





Disclaimer

Always ensure the speaker is securely attached. Phoenix Gold accepts no responsibility for damage or injury in relation to inappropriate securing of this product.

Phoenix Gold Product Warranty

LIMITED WARRANTY ON SPEAKERS

Phoenix Gold warrants this product to be free of defects in materials and workmanship for a period of one (1) years from the original date of purchase. This warranty is not transferable and applies only to the original purchaser from an authorized Phoenix Gold dealer. Should service be necessary under this warranty for any reason due to manufacturing defect or malfunction, Phoenix Gold or it's Country distributor / reseller will (at its discretion) repair or replace the defective product with new or re-manufactured product at no charge. Damage caused by the following is not covered under warranty: accident, misuse, abuse, product modification or neglect, failure to follow installation instructions, unauthorized repair attempts, misrepresentations by the seller. This warranty does not cover incidental or consequential damages and does not cover the cost of removing or reinstalling the unit(s). Cosmetic damage due to accident or normal wear and tear is not covered under warranty.